

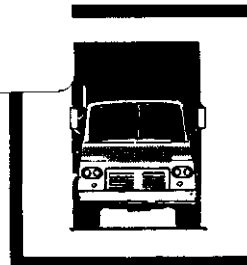
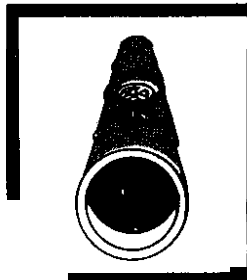
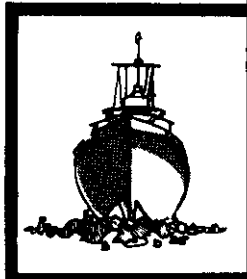


80-10

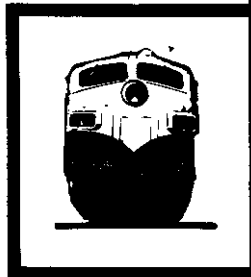

# NATIONAL TRANSPORTATION SAFETY BOARD

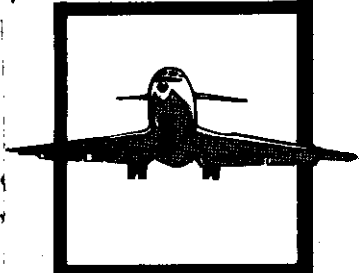

WASHINGTON, D.C. 20594

## AIRCRAFT INCIDENT REPORT

AEROMEXICO  
DC-10-30, XA-DUH  
OVER LUXEMBOURG, EUROPE  
NOVEMBER 11, 1979

NTSB-AAR-80-10

c.5

Doc  
NTSB  
AAR  
80/10  
c.5

UNITED STATES GOVERNMENT

TECHNICAL REPORT DOCUMENTATION PAGE

1. Report No. NTSB-AAR-80-10		2. Government Accession No.		3. Recipient's Catalog No.	
4. Title and Subtitle Aircraft Incident Report— AEROMEXICO DC-10-30, XA-DUH, Over Luxembourg, Europe, November 11, 1979				5. Report Date November 7, 1980	
				6. Performing Organization Code	
7. Author(s)				8. Performing Organization Report No.	
9. Performing Organization-Name and Address National Transportation Safety Board Bureau of Accident Investigation Washington, DC. 20594				10. Work Unit No. 2998	
				ii. Contract or Grant No.	
12. Sponsoring Agency Name and Address  NATIONAL TRANSPORTATION SAFETY BOARD Washington, D. C. 20594				13. Type of Report and Period Covered  Aircraft Incident Report November 11, 1979	
				14. Sponsoring Agency Code	
15. Supplementary Notes					
16. Abstract <p>About 2138, on November 11, 1979, AEROMEXICO, Flight 945, XA-DUH, McDonnell-Douglas DC-10-30 aircraft, entered a prestall buffet and a sustained stall over Luxembourg, Europe, at 29,800 ft while climbing to 31,000 ft en route to Miami, Florida, from Frankfurt, Germany. Stall recovery was effected at 18,900 ft. After recovery, the crew performed an inflight functional check of the aircraft and, after finding that it operated properly, continued to their intended destination.</p> <p>After arrival at Miami, Florida, it was discovered that portions of both outboard elevators and the lower fuselage tail area maintenance access door were missing. There were no injuries to the 311 persons on board Flight 945. No injuries or damage to personnel or property on the ground was reported.</p> <p>Visual meteorological conditions prevailed at the time of the incident.</p> <p>The National Transportation Safety Board determines that the probable cause of the incident was the failure of the flightcrew to follow standard climb procedures and to adequately monitor the aircraft's flight instruments. This resulted in the aircraft entering into a prolonged stall buffet which placed the aircraft outside the design envelope.</p>					
17. Key Words				18. Distribution Statement This document is available to the public through the National Technical Information Service, Springfield, VA 22161	
19. Security Classification (of this report) UNCLASSIFIED		20. Security Classification (of this page) UNCLASSIFIED		21. No. of Pages 32	
				22. Price	

## CONTENTS

SYNOPSIS . . . . .	1
1.Factual Information . . . . .	1
1.1 History of Flight . . . . .	1
1.2 Injuries to Persons . . . . .	4
1.3 Damage to Aircraft . . . . .	4
1.4 Other Damage . . . . .	4
1.5 Crew Information . . . . .	4
1.6 Aircraft-Information . . . . .	4
1.7 Meteorological Information . . . . .	7
1.8 Aids to Navigation . . . . .	7
1.9 Communications . . . . .	7
1.10 Aerodrome Information . . . . .	7
1.11 Flight Recorders . . . . .	7
1.12 Aircraft Examination . . . . .	10
1.12.1 Structures . . . . .	10
1.13 Medical and Pathological Information . . . . .	12
1.14 Fire . . . . .	12
1.15 Survival Aspects . . . . .	12
1.16 Test and Research . . . . .	12
1.16.1 Powerplant . . . . .	12
1.16.2 Metallurgical Examination . . . . .	12
1.17 Other Information . . . . .	13
1.17.1 Autopilot and Flight Director Engagement Modes; Operation . . . . .	13
1.17.2 Autothrottle Speed Control System (AT/SC) . . . . .	16
1.17.3 Stall Warning . . . . .	17
1.17.4 Climb Operations with the Flight Guidance and Control System . . . . .	17
1.17.5 Structural Certification Tests and Analysis . . . . .	17
1.17.6 Applicable Federal Regulations . . . . .	18
2.ANALYSIS . . . . .	18
3.CONCLUSIONS . . . . .	22
3.1 Findings . . . . .	22
3.2 Probable Cause . . . . .	23
4.SAFETY RECOMMENDATIONS. . . . .	23
5.APPENDIXES . . . . .	25
Appendix A—Investigation and Hearing . . . . .	25
Appendix B—Personnel Information . . . . .	26
Appendix C—Aircraft Information . . . . .	27
Appendix D—DFDR Data Graph for Altitude, IAS and Heading . . . . .	28
Appendix E—DFDR Data Graph for Altitude, Pitch and Roll . . . . .	29
Appendix F—DFDR Data Graph for Altitude, Elevator, Rudder and Aileron . . . . .	30
Appendix G—DFDR Data Graph for Altitude, $N_1$ for All Engines. . . . .	31

NATIONAL TRANSPORTATION SAFETY BOARD  
WASHINGTON, D.C. 20594

AIRCRAFT INCIDENT REPORT

Adopted: November 7, 1980

---

---

AWOMEXICO  
DC-10-30, XA-DUH  
OVER LUXEMBOURG, EUROPE  
NOVEMBER 11, 1979

SYNOPSIS

About 2138, on November 11, 1979, AEROMEXICO, Flight 945, XA-DUH, a McDonnell-Douglas DC-10-30 aircraft, entered a prestall buffet and a sustained stall over Luxembourg, Europe, at 29,800 ft while climbing to 31,000 ft en route to Miami, Florida, from Frankfurt, Germany. Stall recovery was effected at 18,900 ft. After recovery, the crew performed an inflight functional check of the aircraft and, after finding that it operated properly, continued to their intended destination.

After arrival at Miami, Florida, it was discovered that portions of both outboard elevators and the lower fuselage tail area maintenance access door were missing. There were no injuries to the 311 persons on board Flight 945. No injuries or damage to personnel or property on the ground was reported.

Visual meteorological conditions prevailed at the time of the incident.

The National Transportation Safety Board determines that the probable cause of this incident was the failure of the flightcrew to follow standard climb procedures and to adequately monitor the aircraft's flight instruments. This resulted in the aircraft entering into a prolonged stall buffet which placed the aircraft outside the design envelope.

1. FACTUAL INFORMATION

1.1 History of the Flight

On November 11, 1979, AEROMEXICO, XA-DUH, Flight 945, a McDonnell-Douglas DC-10-30 aircraft, was operating as a charter passenger flight between Frankfurt, Germany, and Mexico City, Mexico DF, with an en route refueling stop at Miami, Florida. About 2119 G.m.t., 1/ AEROMEXICO 945 departed Frankfurt, Germany, on an instrument flight rules (IFR) flight plan to Miami; 295 passengers, 3 flightcrewmembers, and 13 flight attendants were on board.

---

1/ All times herein are Greenwich mean, based on the 24-hour clock, unless otherwise noted.

According to the crew, the aircraft preflight, engine start, taxi, takeoff and the initial portion of the en route climb were uneventful. At 1,500 ft aboveground level, with the captain at the controls, the crew engaged the No. 1 autothrottle system (ATS) and selected the N<sub>1</sub> 2/ mode. The captain requested permission from air traffic control (ATC) to climb at 283 kns, 3/ the appropriate speed for the heavy weight of the aircraft. The captain stated that he continued to control the aircraft manually to 10,000 ft with both flight directors (FD) in the FD position. However, upon climbing through 10,000 ft, the ATS speed selector was positioned to 320 kns and the flight director/autopilot (FD/AP) was programmed to have the AP fly the aircraft in the indicated airspeed hold mode (IAS Hold) with the No. 1 AP engaged in the command (CMD) position. The thrust rating computer (TRC) was set at climb power.

While climbing through 14,000 feet m.s.l., the AP became disengaged. The captain reengaged it by positioning the No. 1 AP lever to the CMD position and then pressed the inertial navigation system (INS) selector in the heading (HDG) panel. No other FD/AP modes were reselected. The pilot commented to his crew that if the AP disengaged again, they would write it up in the aircraft logbook.

According to the crew, while climbing through 27,500 ft about 100 miles west of the departure airport, they felt a vibration which, within seconds, increased in intensity. The crew suspected an abnormal vibration in engine No. 3 and elected to reduce its power and then to shut it down. The crew also stated that, upon reducing power on engine No. 3, the aircraft assumed a pitch down attitude, the AP became disengaged, and the aircraft rolled to the right and then to the left and started to lose altitude.

The Digital Flight Data Recorder (DFDR) revealed that, after the No. 3 engine power was reduced, the aircraft decelerated into speeds that were below the stall buffet speed and the design flight envelope. Shortly thereafter, the nose dropped and the aircraft entered into a stall while at 29,800 ft and an IAS of 226 kns.

The calculated stall speed for the flight at the time of the occurrence was 222 kns. The calculated buffet onset speed was about 241 kns. The DFDR showed a constant rate of climb until the stall and loss of altitude occurred. It also showed that the airplane noseup elevator was held between 9° and 18.2° throughout most of the recovery maneuver until the elevator was gradually relaxed with recovery from the stall starting at about 24,500 ft.

The captain said that as the aircraft nose dropped, the spoilers were deployed to arrest the impending overspeed condition that could have been created by the aircraft's nose low attitude. About 10 seconds later, the autoslats extend system became active. The DPDR readout showed the recovery started at 23,900 ft. At that time, the airspeed increased to a value above the calculated stall speed. The vertical acceleration reached a maximum of 1.68 g's during the recovery process which ended at an altitude of 18,900 ft, and the crew regained full control of the aircraft about 18,000 ft. According to the crew, when aircraft

2/ Engine fan speed percent indicator.

3/ The maneuvering speed of the aircraft with flaps and gear up, designated as V<sub>A</sub>.

control was lost, the first officer declared an emergency. During that period, the DFDR showed that the aircraft was responding in a normal manner to crew control inputs.

According to French ATC officials, at 2143 AEROMEXICO Flight 945 announced a "Mayday" and loss of control at 31,000 ft while flying in an area 20 nmi from Chatillon, France, (CTL) VOR. The pilot advised that he was executing an emergency descent. Later, he advised that he had regained control of the aircraft at 19,000 ft and requested permission to divert to Madrid, Spain. French ATC authorized the flight's diversion.

Shortly after recovering control of the aircraft, the crew airstarted engine No. 3. It appeared to be functioning normally with all parameters indicating within normal limits with no indication of vibration.

The crew stated that there was no malfunction or failure of any system noted during the entire flight other than the autopilot becoming disconnected while climbing through 14,000 ft m.s.l. and the vibration, which was suspected as emanating from engine No. 3.

According to the flight engineer, the aircraft hydraulic system was configured with the left pumps feathered and the right pumps on for each engine; the motor-pumps were in the armed position. At no time did he detect a hydraulic low quantity or low pressure condition. After regaining control of the aircraft, the flight engineer assessed the conditions in the aircraft and found only a few ceiling panels in the passenger cabin detached. A functional test of all systems pertinent to the flight control systems and flight guidance system was completed by the crew with satisfactory results.

The captain stated that since all systems appeared to be functioning normally and since a landing at Madrid would require dumping 140,000 pounds of fuel he elected to continue the flight to Miami, Florida. According to French ATC, shortly after issuing clearance to Madrid, the flight requested and received clearance to proceed to Miami.

The flight climbed in visual meteorological conditions to 28,000 ft and then to 31,000 ft, ending at 33,000 ft near Bermuda while cruising at Mach .82 (385 kts) in an ambient temperature of international standard atmosphere (ISA) +9°C (static air temperature -41°C). The flight landed at Miami, Florida, on November 12, 1979, at 0705 without any further problems.

Upon arriving at the passenger terminal gate, the captain requested that maintenance personnel give the aircraft a visual exterior inspection. It was found that about 4 ft of each outboard elevator tip, including the corresponding counterweights and the aircraft's tail area lower access door were missing.

The aircraft was grounded at Miami, Florida, where it underwent a detailed inspection, a thorough examination, and a functional test of all flight control systems, ATS, AP/FD, engine No. 3, and all other related systems that could have induced the condition experienced by the crew during the incident. No discrepancies were noted.

The aircraft's left and right outboard elevator and the fuselage tail lower area access door were replaced and the aircraft was flown to Mexico City, on November 16, 1979, where it again went through a detailed inspection in accordance with AEROMEXICO's Approved Inspection and Maintenance Program. No discrepancies were found during the examination and testing of the aircraft. Later, it was released for scheduled line flight operations.

**12 Injuries to Persons**

There were no injuries to persons.

**1.3 Damage to Aircraft**

The aircraft damage was confined to both aircraft outboard elevator tips and related counterweights and the tail lower area access door. (See figures 1 and 2.)

**1.4 Other Damage**

There was no other damage.

**1.5 Crew Infamation**

All flight and cabin personnel were qualified in accordance with ICAO and Mexican Government regulations. The flight crewmembers had successfully completed an AEROMEXICO approved training program for DC-10 aircraft. (See appendix B.)

All crewmembers had been off duty for 24 hours before reporting for the flight.

**16 Aircraft Infamation**

XA-DUH was owned and operated by AEROMEXICO. It was certificated, maintained, and equipped in accordance with current Mexican Government regulations and ICAO standards.

The aircraft weight and balance documentation for departure from Frankfurt, Germany, showed that the aircraft had a zero fuel weight of 324,831 pounds and a load of 230,383 pounds of jet fuel. Its maximum allowable certificated **gross** weight was **555,000** pounds. Its takeoff **gross** weight was 555,096 pounds and its center of gravity (c.g.) was 17.6 percent. The critical engine failure speed (V<sub>1</sub>) was 170 kns; the rotation speed (V<sub>R</sub>) was 180 kns; the takeoff safety speed (V<sub>2</sub>) was 189 kns; and the maneuvering speed (V<sub>A</sub>) was 283 kns.

To meet the second segment climb requirements, the aircraft departure on runway 25R at Frankfurt was limited to 6.9° of wing flaps for a takeoff with reduced power at maximum certificated **gross** weight. The reduced power was used for engine and fuel conservation purposes. The aircraft had to accelerate to 283 kns, design maneuvering speed (V<sub>A</sub>), to maneuver on course at the departure takeoff gross weight.



Figure 1.--View of left outboard elevator tip.





**Figure 2.--View of right outboard elevator tip.**

At an average consumption of about **11,000** pounds of fuel per engine/hour, it was estimated that the aircraft engines burned about **11,000** pounds of fuel from the time of departure to the time of the incident, which reduced the aircraft gross weight to an estimated **544,000** pounds.

**1.7**            Meteorological Information

Visual meteorological conditions prevailed at the time of the incident. Weather was not a factor in this incident.

**1.8**            Aids to Navigation

Not applicable.

**1.9**            Communications

There were no known communication malfunctions.

**1.10**          Aerodrome Information

The Frankfurt/Main Airport (EDDF) is located at Frankfurt, Germany. The airport elevation is **368 ft m.s.l.** Runway **25R** is **12,795 ft (3,900 meters)** long and **197 ft (60 meters)** wide, and it has a **0.25** percent upslope in that direction.

**1.11**          Flight Recorders

The aircraft was equipped with a Sundstrand Digital Flight Data Recorder (DFDR) Model **981-6009**, S/N **2632**. The aircraft's DFDR was obtained from the airline officials and sent to Douglas Aircraft Company in Long Beach, California, 5/ where it was read out under the supervision of NTSB investigators.

Although the entire flight was recorded on the DFDR tape, the data printout was limited to only the portion relating to the incident, between **21:37:04** and **21:44:08**, and only **6 minutes 40 seconds** of the recorded parameters were plotted. (See appendixes D through G.) The parameters included in the printout were indicated airspeed, altitude, pitch and roll attitude, elevator, rudder and aileron, horizontal stabilizer, spoiler and slat positions, vertical acceleration, engine thrust, heading, and vertical speed. The discrete functions recording slat positions were not operating properly.  $V_{mo}/M_{mo}$ , the aerodynamic load limits or acceleration limits, were not exceeded during the incident.

The **7 minute 4 second** period covered by the processed data began when the aircraft climbed through an altitude of **25,011 ft m.s.l.** and ended when the aircraft stabilized about **19,178 ft m.s.l.** During the first **4 minutes 12 seconds**, the aircraft climbed steadily about **1,200 ft per minute** as the IAS decreased from **318** to **226 kns** and the pitch angle increased from **4.5'** to **11'** noseup. This type of climb profile is consistent with the type of profile expected in DFDR tape readouts from aircraft that are climbing in the FD/AP vertical speed (VERT SPD) mode. An

---

5/ The NTSB's readout station was being repaired at the time of the incident.

aircraft climbing in the IAS Hold or Mach Hold modes will not maintain a steady climb profile, but rather the rate of climb will decrease with the decrease in air density as the flight climbs into higher altitudes.

About 21:41, the  $N_1$  speed of engine No. 3 began to decrease to flight idle. The  $N_1$  speed of engine No. 3 remained at about 20 percent during the entire incident. The final minutes covered by the readout revealed, in part, the following evidence:

21:40:56 to 21:41:16

- o Aircraft IAS decreased from 247 to 226 kns while in a steady climb profile from 29,510 to 29,834 ft.
- o Aircraft pitch attitude increased from 8° to 11° noseup. Roll attitude went from wings level to 14° right wing down.
- o The horizontal stabilizer was deflected from 4.2' to 6.0' noseup. The aircraft heading changed from 264° to 271°, and the aircraft entered into a buffet onset speed and later into a prolonged stall.

21:41:16 to 21:41:26

- o IAS decreased from 226 to 208 and then to 197 kns as the aircraft descended through 29,600 ft while still in a stalled condition.
- o Aircraft pitch attitude increased from 11.0° to 17.4' noseup.
- o The spoilers were deployed and stayed deployed for 75 seconds.
- o The left inboard elevator sensor indicated that the elevators started an excursion from 1° up to 12° up and then to 10° up.
- o The horizontal stabilizer deflected from 6.0' to 6.69' noseup. Although the aircraft was in a stalled condition, the elevators were commanding noseup, and the horizontal stabilizer was trimming for the noseup command. The aircraft heading changed from 271° to 283° and then to 272.7° while the No. 2 engine  $N_1$  rpm decreased to about 90 percent and then began to fluctuate at 100 ±5 percent which continued for about 45 seconds.

21:41:26 to 21:41:36

- o Aircraft IAS decreased to 178 kns as it descended through 28,900 ft in a stall. Aircraft pitch attitude decreased from 17.3° noseup to 14.8' noseup.
- o The lower rudder sensor indicated that the rudders were deflected from 1.4° right to 11° left, which was beyond the 5° authority of the yaw damper.

- o* Vertical acceleration remained about **.9-g** loads. The elevators continued in an excursion from **10°** up to **8°** up and then to **19'** up.
- o* The horizontal stabilizer deflected from **6.69'** noseup to **8.33'** noseup.
- o* The aircraft heading changed from **272°** to **274'** and then to **272°**. The rate of descent was reduced from about **4,200** to about **600** ft per minute.

**21:41:36 to 21:41:56**

- o* The aircraft IAS decreased from **178** to **175** kns and then increased to **217** kns as the aircraft continued to descend through **25,600** ft at about **10,156** ft per minute.
- o* The aircraft pitch attitude decreased from **14.8'** noseup to **10.9'** nosedown and then to about **6.6'** nosedown.
- o* The roll attitude continued an excursion from **3°** left wing low to **23.5'** left wing low to **25°** right wing low to **3°** right wing low to **13°** right wing low and then to **5°** left wing low. The rudder deflected from **12°** left to **3°** left.
- o* Vertical acceleration changed from **.9** to **0.65** to **1.0** g.
- o* The elevators oscillated from **17°** up to **9°** up and then to **16°** up.
- o* The horizontal stabilizer deflected from **8.33°** noseup to **9.46'** noseup and then to **6.48°** noseup.
- o* The aircraft heading changed from **272°** to **264'** and then to **278°**

**21:41:56 to 21:42:06**

- o* The aircraft IAS continued to increase from **217** to **248** kns as the vertical speed continued to increase to **15,000** ft per minute rate of descent at **23,300** ft. The aircraft vertical acceleration changed from **1.0** to **1.4** g.
- o* The elevators deflected from **13.7'** up to **8.4'** up as the stabilizer deflected from **6.48°** noseup to **9.56'** noseup. The heading changed from **278°** to **276°**.

**21:42:06 to 21:42:16**

- o* The aircraft IAS increased to **267.5** kns as the vertical speed slowed to about **11,988** ft per minute while descending through **21,600** ft.

- o The aircraft pitch attitude started an excursion between 5.2° nosedown to 5.7° noseup. The roll attitude went from wings level to about 5.7° left wing down.
- o The vertical acceleration oscillated between 1.4 to 1.1 to 1.68 g (the highest g load experienced during the occurrence). The elevators changed from 8.4° noseup to near neutral as the horizontal stabilizer increased to 9.87° noseup. The aircraft heading remained nearly constant at about 276.

21:42:16 to 21:44:08

- o The aircraft IAS decreased as recovery became evident through a decreasing rate of descent and coordinated maneuvers which started about 21,600 ft and ended in a level controlled flight about 18,900 ft. The sequence of events was appropriate for a stall recovery in contrast with the sequence of events preceding 21:42:16 during which it appeared that the aircraft control inputs were correcting in the wrong direction for a stall recovery.

## **1.12 Aircraft Examination**

### **1.121 Structures**

The airframe was inspected with emphasis on the empennage, control systems, and aft fuselage. The slats were inspected, and no evidence of either overload damage or other defects was found. The damage to the empennage was localized in the outboard elevator tips and the adjacent stabilizer tip fairings. Aft fuselage damage was limited to the tail cone access door. The elevator control system from the surfaces through the actuators was rigged properly. Numerous cabin ceiling panels, light fixtures, and an oxygen mask had been dislodged; however, most of these had been reinstalled by the cabin crew.

#### **(a) Horizontal Stabilizer and Elevators**

Approximately 4 ft of the outboard ends of both outboard elevators were missing and had separated at almost identical locations. The approximate line of separation connected the trailing edge channel at Station XE 436 to the elevator spar at Station XE 455. The elevator outboard hinge fitting mounted on the elevator spar and the eyebolt mounted on the hinge fitting had separated with the outboard end of the elevators. Visual examination of the fracture surfaces on the elevator showed no indication of prior cracking. The fracture surfaces were clean and bright with smearing on some portions of the sheet metal surfaces.

The left outboard elevator hinge fail safe "A" frame attached to the horizontal stabilizer sustained minor damage. Scrape marks a few thousandths of an in deep were evident in the bore and flange of the bushing. The outboard lug of the two lugs on the outboard hinge "A" frame was broken about 1 in forward of the elevator hinge line. The inboard lug was bent inboard approximately 1/8 in, and

the hinge line hole was elongated about 1/16 in. in an upward and aft direction. Caked grease surrounded an area approximately .090 in wide around the edge of the hinge hole. The horizontal stabilizer tip fairing had a buckle about 1/2 in deep and 4 in long just forward of the aft closing rib in the fairing. The aft edge of the fairing was bent outward about 1/8 in, and there was an impact mark on the fairing at this location.

The right outboard elevator outboard hinge fail safe "A" frame attached to the horizontal stabilizer was broken about 2 in forward of the hinge line. No indication of prior cracking was evident. The outboard lug of the two lugs on the outboard hinge "A" frame was broken about 2 in forward of the hinge line. No indication of prior cracking was evident. The inboard lug was bent inboard about 1/2 in. A scrape mark approximately .005 in deep was observed on the outboard side of the inboard lug. The scrape mark extended from the edge of the hinge hole to the upper edge of the lug. The horizontal stabilizer tip fairing had two small buckles about .060 in deep and 2 in long located just forward of the aft closing rib. The aft edge of the fairing was bent outboard approximately 1/16 in and an impact mark was evident on the aft edge of the fairing.

Both horizontal stabilizers sustained minor damage and deformation to the trailing edge panels at the outboard end. External visual examination of the horizontal stabilizer box structure did not reveal any damage.

(b) Aft Fuselage

The tail cone access door, which opened to the rear, had been torn from the structure. The door frame in the area of the hinge had been cracked and the skin was torn and bent.

(c) Control Systems

The flight control surfaces (ailerons, elevators, rudder, spoilers, slats, flaps, and horizontal stabilizer) were operated through their full travel with no motion abnormalities observed. The rudder, ailerons, and elevators were also subjected to sharp step inputs with no problems observed. The entire hydraulic system was tested and found to be functioning properly. The surface position indicator and flap/slat instrument performed satisfactorily during the control system operation.

The flight directors and autopilots were operated and no anomalies were observed. Each autopilot and flight director was engaged into the V/S, IAS Hold, Mach Hold, Turb and Altitude Hold modes in pitch, and was engaged in Heading Hold, Heading Select, and VOR modes in roll. The manual control wheel steering mode was also satisfactorily tested.

The elevators were deflected for aircraft noseup and aircraft nosedown using the V/S wheel; the ailerons were deflected using HDG SEL and VOR modes. The control surface deflections and authorities visually appeared correct and no oscillation or dithering was observed. Each AP was disengaged by operating each control wheel disconnect switch and the engage lever. The AP red flashing

disengage lights and engage lever operation were normal. Override forces were applied in pitch and roll to each column while each AP was engaged in CMD. Reversion to the "MAN" mode occurred in all cases. The overhead yaw damper test was successfully performed with all four channels engaged. The automatic pitch trim was tested while the AP's were in the manual mode and pitch forces applied in both the ANU and AND direction. The stabilizer rate and direction appeared correct.

The autothrottles were engaged and disengaged with the throttle disconnect switches. Annunciation of the speed mode and the ATS flashing red lights at disconnect were normal. The left and right stall test was performed and the stickshaker was actuated in about 5 seconds. The auto-slat extend test was also performed. The slat disagree and slat reset light illuminated and the slats extended when the test switch was operated. When the slat reset switch was actuated, both slats retracted and the lights extinguished. When the required circuit breakers were closed and the appropriate switches were actuated to establish the aircraft in a configuration to perform the above functional tests, all pertinent "flags," lights, and instruments operated normally.

**1.13      Medical and Pathological Information**

Not applicable.

**1.14      Fire**

There was no fire.

**1.15      survival Aspects**

Not applicable.

**1.16      Test and Research**

**1.16.1    Powerplant**

Engine No. 3 was borescoped, and no evidence of distress, which would have caused a vibration in the engine, was found. A visual inspection of the fan was performed, and no fan damage was found which would have caused a high level of vibration.

**1.16.2    Metallurgical Examination**

The outboard ends of the right and left elevator panels had separated in flight. Visual examination of the breaks, with a bench binocular microscope, disclosed overload characteristics in the hinge separations. The elevator panel separations contained appreciable mechanical damage to the fracture surfaces; however, in all areas that were not damaged, the features appeared typical of an overstress condition. No evidence of low load-high cycle fatigue was found on any break examined. The outboard elevator was checked and was found to conform to material specifications.

## 1.17 Other Information

XA-DUH is equipped with a flight guidance and control system (FGCS) which includes a dual autothrottle/speed control system (AT/SC), a dual flight director (FD) system, and two dual channel autopilot (AP) systems. The flight guidance computers provide intelligence to the autopilot and the flight director systems. The flight director system and the autopilot share many of the same modes, and the FGCS modes are selected in the same manner as the autopilot modes. The FGCS control panel, which is located in the center of the glareshield, provides the means of selecting and engaging the modes of operation. (See figure 3.) The mode annunciator panel and examples of the flight director, autothrottle, and autopilot modes displays appear directly above each pilot's attitude director indicator and mach/airspeed indicator. (See figure 4.) There are four separate displays in each annunciator unit: the autothrottle (AT) mode annunciator and the three autopilot and flight director mode annunciators "Arm," "Roll," "Pitch." Only those system controls and modes involved in this incident are discussed.

### 1.17.1 Autopilot and Flight Director Engagement Modes; Operation

The basic engagement mode of the autopilot is "Command CWS." When an autopilot lever is in the CMD position, both flight mode annunciators display the modes of the engaged autopilot. The basic engagement modes of the FD system are "Heading Hold" and "Altitude Hold," or "Vertical Speed" if the aircraft is climbing or descending. Overpowering the autopilot while in the CMD position will result in the autopilot lever dropping to the Manual (MAN) position, causing red, flashing, autopilot fail lights to come on. In the MAN position, the pilot utilizes the normal control wheel and column. However, because the autopilot is still engaged when the aircraft is placed in a particular attitude, it remains in that attitude until another wheel or column input is applied. The response of the aircraft is proportional to the applied force and movement, but it is limited to certain bank and pitch attitude angles. With an autopilot lever in the MAN position, Command CWS is not annunciated and the flight mode annunciators will display the armed or engaged flight director modes. Certain flight guidance system modes are common to both the autopilot and flight director system, such as "IAS Hold," "Mach Hold," "Vertical Speed," and "Altitude Hold" for pitch. If the autopilot is disengaged while in one of these particular modes, the flight director will remain engaged in the selected FGCS mode. Reengaging the autopilot lever to CMD will place the autopilot in the previously selected FD mode if the flight director is on, or into CWS (annunciated) if the flight director is off.

The manufacturer recommends that the autopilot "Indicated Airspeed Hold" (IAS Hold) and "Mach Hold" (MACH) modes be used primarily to climb or to descend. The IAS and MACH pushbutton switches are seen on the flight guidance and control panel below the autopilot levers in figure 3. With the autopilot in "CMD," pressing one of these switches commands the autopilot to adjust the pitch of the aircraft to maintain the airspeed or Mach existing when the switch was pressed. The pitch mode window annunciates IAS Hold or Mach Hold depending on which switch is depressed.



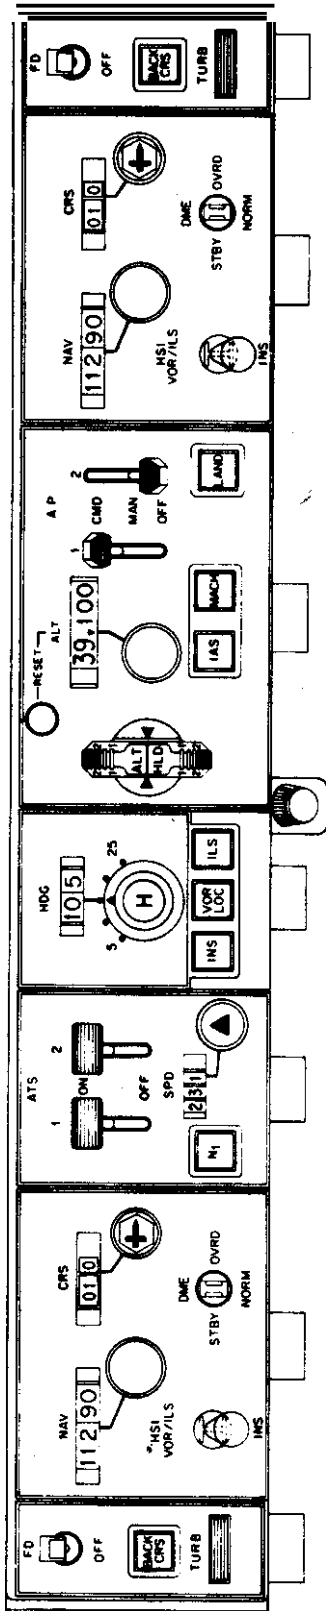


Figure 3.--Flight guidance and control system panel.

FLIGHT DIRECTOR, AUTOTHROTTLE AND AUTOPILOT MODES

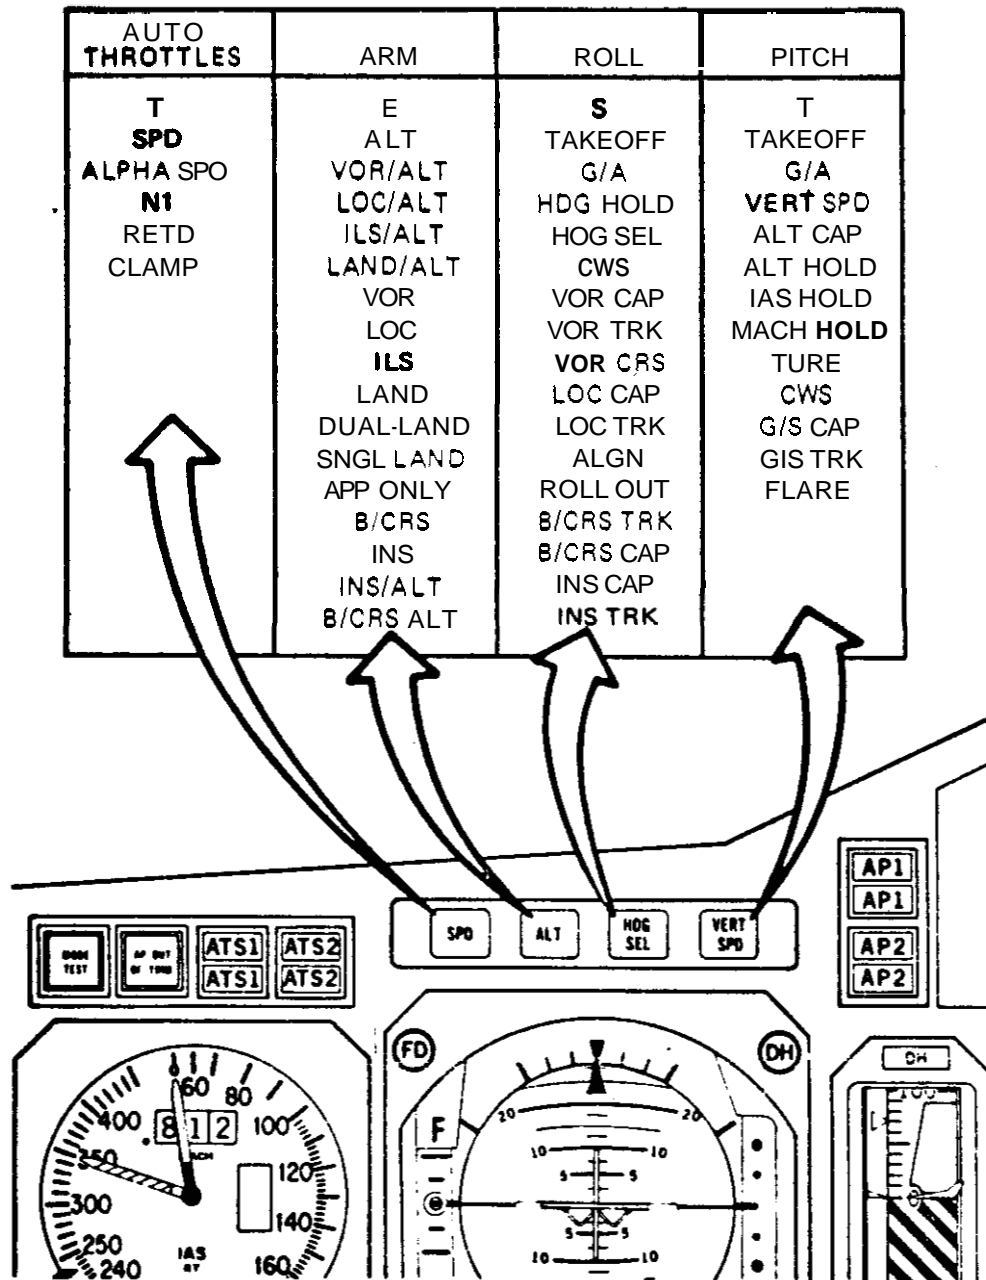


Figure 4.—Mode annunciator panel.

The vertical speed selector on the left side of the autopilot levers on the Flight Guidance and Control Panel, figure 3, is synchronized to the aircraft's vertical speed at all times except when the "Vertical Speed" (VERT SPD) or the "Altitude Hold" (ALT HOLD) mode is engaged. When the vertical speed selector is manually rotated to the altitude hold detent, the flight director pitch command bars will move correspondingly and the pitch annunciator will display "ALT HOLD." The vertical speed selector wheel functions as an indicator or as a control. If the altitude hold mode has been engaged, the vertical speed selector wheel will remain in the altitude hold detent and will command "ALT HOLD." If the vertical speed mode has been engaged (either a climb or a descent), the vertical speed selector wheel will remain in the selected position and will command a climb or a descent at the selected rate. When the "IAS Hold" or "Mach Hold" is engaged, the vertical speed selector wheel will automatically synchronize to the velocity of the aircraft.

### 1.17.2 Autothrottle Speed Control System (AT/SC)

The FGCS includes a dual autothrottle and speed control system. The AT/SC panel provides the means for engaging either or both autothrottle systems and selecting either the "speed" or "N<sub>1</sub>" mode of operation. Its functions provide speed command for takeoff and go-around as either a manual or automatic mode; the "speed mode," available in either manual or automatic, which permits the pilot to select a desired speed; "alpha speed" function which, if autothrottles are in the speed mode, will maintain or indicate the minimum maneuvering speed even if a lower speed is selected; and the N<sub>1</sub> mode, which will automatically advance throttles to a N<sub>1</sub> thrust limit (as determined from the mode selected on the Thrust Rating Computer). The autothrottle speed mode provides protection against stall at all times, plus flap limit overspeed protection. The speed control system utilizes "Fast/Slow" indicators on the left side of each attitude director indicator (ADI) to indicate the relation of actual speed to selected speed. All engaged autothrottle modes are displayed on both the ATS flight mode annunciators. When autothrottles are operated in the speed mode and a speed is selected which is below the aircraft minimum safe maneuvering speed, "ALPHA SPD" will be annunciated to the pilots and the autothrottles will advance the speed to the minimum safe maneuvering speed. If the ATS is not engaged and a speed is selected in the speed readout that is below minimum safe maneuvering speed, the fast/slow indicators in the ADI will be referenced to the minimum safe maneuvering speed (ALPHA SPD). The throttles are an integral part of the ATS, and the No. 1 and No. 3 throttles contain the autothrottle disconnect buttons. The ATS speed mode is incompatible with the FD/AP IAS Hold or Mach Hold modes.

During the speed mode of operation, the autothrottle system maintains the airspeed set in the speed readout through actuation of the thrust levers. In the N<sub>1</sub> mode of operation, which is used for climb and go-around, the autothrottle system maintains the displayed thrust computer limit. During the N<sub>1</sub> mode of operation, except for takeoff or go-around, the fast/slow indicators are out of view. If the autothrottle system is engaged in the speed mode, the autopilot IAS Hold or Mach Hold modes cannot be engaged.

If an autothrottle is engaged, or a speed mode is selected from the N<sub>1</sub> mode by pulling out on the speed select knob, the autopilot IAS Hold or Mach Hold mode will disengage and go into the vertical speed mode.

### 1.17.3 stall warning

The aircraft's inherent stall warning characteristic is supplemented by the stall warning system. This system warns the flightcrew of an approaching stall condition through actuation of a stickshaker located on the captain's control column. The primary sensing elements for stall warning are angle of attack sensors located on the fuselage nose. The flap position transmitter and slat proximity sensors in the outboard slat segments also provide the wing configuration input signals to the stall warning system. Each AT/SC computer contains the signal processing and logic circuitry for stall warning, and the capability to actuate the stickshaker. An automatic slat extension system also extends the outboard slats (for the wing clean configuration) at the time the stickshaker is activated. In this incident, a change in the state of the slat logic (discrete signal) was seen on the digital flight data recorder record, thus indicating that automatic slat extension did occur at the speed it would be expected to have been initiated.

### 1.17.4 Climb Operations with the Flight Guidance and Control System

The manufacturer's Flight Crew Operating Manual instructs the flightcrew to conduct the en route climb in the IAS Hold or Mach Hold mode (FD/AP) and to switch from IAS Hold to Mach Hold when the desired climb Mach number is reached. This method maintains a constant Mach with some decrease in airspeed as the aircraft climbs to the less dense altitudes, keeping a desirable climb profile. The IAS Hold or Mach Hold modes are accomplished by controlling the aircraft pitch attitude, rather than with power changes. The proper autothrottle mode used for the climb is the  $N_1$  mode, which, through the power levers, maintains the climb thrust limit displayed and a desired rate of climb to power ratio. At no time will the FD/AP IAS Hold or Mach Hold attempt to seek and maintain any speed selected in the ATS speed selector as both systems are incompatible.

Some airline procedures allow an alternate use of vertical speed mode for the climb. Airspeed must be closely monitored for the vertical speed climb procedure as this FD/AP mode will try to maintain the climb rate programmed by the vertical speed wheel, regardless of airspeed or Mach. The autopilot will automatically command the trim and elevator to maintain this rate of climb at the sacrifice of airspeed at the higher altitudes. The flight recorder data for this incident showed a constant rate of climb with continually decreasing airspeed before buffet onset and sustained aircraft stall. A speed selection in the ATS speed readout, if it is in the  $N_1$  mode, would not result in any speed control of the aircraft until the ATS speed mode was engaged. If the ATS speed mode was engaged in the climb, a mode conflict between the FD/AP IAS Hold mode would cause the autopilot to revert to the VERT SPD mode. However, both airspeed and the VERT SPD mode of the FD/AP would be conspicuously annunciated. (See figure 4.)

### 1.17.5 Structural Certification Tests and Analysis

An overload condition was experienced during the original DC-10 certification stall tests. That aircraft was not subjected to a prolonged stall;

---

however, the outboard elevator tip skins were permanently buckled; therefore, this area was subsequently strengthened on production aircraft.

The structural motion excited by the stall buffet spectrum at altitudes above 20,000 ft is characterized by a strong 10-Hz torsional mode of vibration. The severity of the motion increases with increased penetration into the stall regime and, based upon analyses and tests, when the c.g. of the balance weight approaches or exceeds 60 g's, a low-cycle high-stress fatigue failure occurs. Although the torsional loads on the tips of the elevators are high, the resulting horizontal stabilizer loads are low and do not threaten the safety of the airplane. Loss of the balance weights presents no unusual hazard to the airplane since the elevator's dual-chamber hydraulic actuator, powered by either of its two hydraulic systems, provides sufficient elevator rotational rigidity to prevent coupled flutter with the stabilizer.

### **1.17.6 Applicable Federal Regulations**

The elevator structure of the DC-10 was designed according to the requirements of 14 CFR 25. Paragraph 25.335(d)(1)(ii) pertains to the stall region of the flight envelope and covers gust conditions at  $V_{s1}$  (stall speed at minimum steady flight) and below. According to the DFDR's vertical accelerometer data, gust conditions were not present.

Paragraph 25.337 requires that the elevator be designed for the limit load factors of +2.5 and -1.0 g's. The DFDR showed that the vertical load factor did not exceed +1.7 g's.

Paragraph 25.393 requires that the elevator and their hinge brackets be designed for inertia loads equal to 12 times the elevator weight acting along the hinge line.

Paragraph 25.629 requires freedom from flutter at 1.2  $V_{mo}$ . The maximum speed in the pullout from the maneuver was 290 kn at 18,600 ft or Mach 0.66. The paragraph also requires that the strength of the attachments for concentrated balance weight on the elevators be substantiated.

## **2 ANALYSIS**

The aircraft was properly certificated, equipped, and maintained in accordance with Mexican regulations and ICAO standards. The aircraft's flight controls, systems, and powerplants operated normally both before and after the incident. There was no evidence that any malfunction of aircraft systems occurred.

The structural damage, which was limited to the empennage and aft fuselage, was attributed to the application of high loads. There was no indication of preexisting fatigue cracking.

The tips of both the right and left elevators separated similarly indicating that the failures were produced by a symmetrical loading condition. The evidence indicated a torsional buckling failure of the elevator skin and an aft bending failure of the spar. Smearing on some of the sheet metal fracture surfaces was consistent with a cyclic load application.

The Safety Board considered those sources of loads which could have caused the failure. There was no evidence of turbulence or gusts in the reported meteorological conditions nor was a gust encounter evident on the acceleration values recorded on the DFDR. There was **also** no evidence on the DFDR that a maneuvering load was applied which could have exceeded the aircraft's limit load factors. Thus, the Safety Board concluded that neither turbulence nor pilot induced maneuvering loads were factors in the incident.

The possibility of aerodynamic surface flutter was also considered. The maximum speeds encountered throughout the flight remained well within the speed envelope for which the aircraft was shown to be free from flutter during certification tests. Additionally, the postincident examination of the aircraft disclosed no evidence of damage to the surface control stops which would have indicated flutter induced overtravel nor were there any control system rigging anomalies which might have caused surface flutter. Also, the irreversible flight **control** system design is not susceptible to flutter problems. The Safety Board thus concluded that aerodynamic flutter was not evident during the flight.

The hypothesis that the loads associated with the structural motion excited by stall buffet produced the damage appeared to be most strongly supported by the evidence. The DFDR data indicates that the aircraft's airspeed continued to decrease during the climb. The theoretical stall speed of the aircraft for its climb weight was determined to be **203** kn and the buffet onset speed according to the Aircraft Flight Manual was approximately **234** kn. According to the DFDR, the aircraft was operated below **234** kn for over **40** seconds while climbing between **26,000** ft and **32,000** ft. During half of this period, the airspeed was below **203** kn. The minimum speed recorded was **175.8** kn, well below the theoretical stall speed. Although the accuracy of the airspeed indication in this range would have been affected by the high angle of attack, the Safety Board believes that the other DFDR parameters leave no doubt that the aircraft encountered an aerodynamic stall. That the aircraft pitch attitude decreased from over **14°** noseup to over **10°** nosedown while nearly full noseup elevator deflection was held clearly indicates that the aircraft was in a fully stalled condition.

The original DC-10 certification stall tests showed that the aircraft could encounter buffet of sufficient magnitude to produce damaging loads on the elevator structure. Therefore, the Safety Board concludes that this aircraft encountered significant buffet as it approached, entered, and recovered from the stall region and that the resultant cyclic loads, which were applied to the elevator balance weights and which were transmitted to other structures along with the normal loads applied to the structure, exceeded the design strength of the elevator as modified following aircraft certification tests.

The analysis of this incident thus focused on those factors which might lead an experienced professional flightcrew to unknowingly allow a DC-10 aircraft to fly into a full aerodynamic stall.

The crew stated that the autothrottle system (ATS) had been engaged as they climbed through 1,500 ft aboveground level and that the aircraft was controlled manually until reaching 10,000 ft where the autopilot (AP) was engaged in the IAS mode and the ATS speed selector was positioned to 320 kn. The crew further stated that, while climbing through 14,000 ft, the autopilot was reengaged by the captain after becoming disengaged. The first indication of a problem, was apparent to the crew as the aircraft climbed through 27,500 ft, when they noticed a vibration which they attributed to the No. 3 engine. They reduced power on the No. 3 engine and the aircraft pitched down and rolled.

The actions described by the crew regarding the ATS and AP selections are not compatible with the system design. The system design is such that airspeed can be controlled by the ATS through modulation of thrust level while the pitch attitude of the aircraft is controlled by criteria other than airspeed; or airspeed can be controlled by the AP through variation in pitch attitude while thrust is maintained at a constant level or is controlled to a maximum limit. The system design will not permit the simultaneous selection of airspeed control on both the ATS and AP. Thus, the crew's recollections of the ATS and AP selections must have been incorrect and imply that they were not completely knowledgeable in the use of the DC-10 flight guidance and control systems.

For an initial climb to cruising altitude, normal autoflight procedures would be to select the N<sub>1</sub> mode of autothrottle operation and the IAS (or Mach) Hold mode for autopilot operation. With these selections, the engine thrust would be continually modulated to the maximum allowable (continuous) level as determined by the thrust computer. The pitch attitude of the airplane would vary to maintain the AP selected airspeed. The aircraft's vertical speed would also vary during the climb as the engine thrust decreases with the changing ambient environment. The vertical speed would begin high and decrease as altitude is gained.

The DFDR data, however, do not substantiate this type of climb profile. Rather, the data show that the aircraft, as it climbed through 25,000 ft, was maintaining a nearly constant rate of climb of about 1,200 ft per minute at an IAS of 318 kn. During the subsequent 4 minutes, the rate of climb was a constant 1,200 ft per minute while the airspeed decreased to 226 kn and the pitch attitude increased from 4.5° to 11° nose up. This performance is most consistent with that which would be produced with the ATS engaged in the airspeed mode and the AP engaged in the vertical speed mode. With these selections, a constant vertical speed would be maintained by AP pitch attitude control and a constant airspeed would be maintained by engine thrust modulation. This is contingent however, on the relationship between thrust required and thrust available. As the climb progresses, the aircraft will reach an altitude where the ATS system would be commanding the maximum continuous thrust level. Beyond that altitude, the aircraft would be unable to maintain both the AP selected vertical speed and the ATS selected airspeed because of a thrust deficiency. The AP however, would

---

continue to command the increasing pitch attitude necessary to achieve the selected vertical speed, regardless of the aircraft's airspeed or angle of attack. There are no angle of attack limits in the AP circuitry to prevent the aircraft under these circumstances from entering a stall.

The Safety Board thus concludes that the crew erred in both their actions and recollections regarding the AP mode selection. It is probable that the flightcrew did begin, or intended to begin, the climb with the ATS N<sub>1</sub> mode/AP IAS mode selections. However, when the captain selected 320 kn into the ATS speed window he may have either intentionally or unintentionally pulled the ATS speed selector knob. This action would have changed the ATS selection from the N<sub>1</sub> mode to the airspeed mode. This in turn would have caused the AP IAS Hold mode to disengage and revert automatically to the vertical speed mode of operation. In any case, the DFDR indicates that the AP was in the vertical speed mode from about 16,000 ft upward. The Safety Board cannot explain why corresponding indications on the mode selection panels failed to alert the flightcrew to these selections.

The Safety Board finds it even more difficult to reconcile the crews lack of awareness of the airspeed and attitude changes and of other stall indications during the several minutes preceding the stall. In accordance with the Federal standards which require that a transport category aircraft have an unmistakable warning of impending stall, the DC-10 stickshaker system augments natural aerodynamic stall warning by introducing a vibration to the captain's control column. Postincident tests verified that the system operated properly. Therefore, the Safety Board concludes that this system must have activated as the aircraft approached the stall, but that none of the above conditions alerted the crew to the impending stall. Consequently, the Safety Board can only conclude that the crew's attention must have been diverted from the control of the airplane and from instrument scan soon after engaging the autopilot. Believing that the autopilot was effectively maintaining a satisfactory climb attitude and speed, they probably were surprised at the control column vibration or the onset of stall buffet or a combination of both and consequently misinterpreted these cues as an engine problem. The DFDR engine thrust parameters confirm that the thrust level (throttle) for the No. 3 engine was retarded and that the resultant decrease in total thrust along with the thrust asymmetry aggravated the aircraft's entry into a full stall.

Although the crew failed to recognize the approach and entry to the stall, they did, after approximately 1 minute, recognize the aircraft's stalled condition and responded with proper control to recover. A full minute for stall recognition is excessive. However, the DC-10's stall warning system consists only of a stickshaker, the operation of which might be misinterpreted by an inattentive or distracted flightcrew, particularly when the aircraft is controlled by the autopilot rather than a pilot. Although the flightcrew on this incident was not attentive to the aircraft's condition, a more explicit stall warning device might have alerted them sooner to the aircraft's true condition during its approach to the stall. We note that some transport aircraft, in addition to a stickshaker, have both visual and aural stall warning devices. We believe that either of the latter would have more quickly resolved the flightcrew's stall recognition problem and might



have prevented damage to the aircraft. Consequently, since stall problems can be encountered by a legitimately distracted flightcrew, we believe that the stall warning system in the DC-10 should be improved to include either a visual or aural warning device, or both.

The Safety Board views with concern the decision of the flightcrew to continue on to their scheduled destination after the incident occurred. The violent, as well as the unexpected, nature of the incident and the flightcrew's initial lack of understanding of the reason for the occurrence should have been sufficient reason to terminate the flight and land as soon as practicable. Therefore, the Safety Board believes that a more prudent judgment would have been to land and assess the reason for the loss of control as well as possible damage to the aircraft.

### 3. CONCLUSIONS

#### 31 Findings

1. The aircraft was maintaining a constant vertical speed during the period of time immediately preceding the incident.
2. Thrust from all three engines was at an autothrottle limiting value for several minutes during which pitch attitude increased and airspeed decreased.
3. The relationship between aircraft attitude changes and flight control commands and the minimum airspeeds recorded indicate that the aircraft was in an aerodynamic stall.
4. The autopilot system was commanding aircraft pitch attitude and the autothrottle system was controlling thrust during the climb preceding the stall.
5. The autopilot system was in a vertical speed mode rather than an airspeed or mach command mode during the climb contrary to AEROMEXICO's procedures and contrary to the manufacturer's prescribed normal operating procedures and recommendations.
6. The autopilot commanded an increasing angle of attack while attempting to maintain a preselected vertical speed which exceeded the limit thrust performance capability of the aircraft at higher altitudes.
7. The flightcrew was distracted or inattentive to the pitch attitude and airspeed changes as the aircraft approached the stall.
8. The flightcrew misinterpreted the stall buffet or the stall warning stickshaker or a combination of both as a No. 3 engine vibration.

9. The flightcrew retarded the No. 3 engine thrust lever and the resultant thrust decrease and thrust asymmetry aggravated the stall entry.
10. Stall recovery procedures were implemented approximately 1 minute after stall entry and a successful recovery was effected
11. The total altitude loss from stall to complete recovery was approximately 11,000 ft. The aircraft did not exceed  $V_{mo}/M_{mo}$  and neither aerodynamic load limits or acceleration limits were exceeded.
12. The stall buffet which was encountered as the aircraft approached and entered the stall produced a dynamic load on the elevator balance weights which resulted in structural overload and failure of the outboard elevator tips.
13. The control of the aircraft following the incident was not adversely affected by the loss of the tips of the outboard elevators.
14. The flightcrew was not thoroughly knowledgeable of the aircraft's flight guidance and control system.

32 **Probable Cause**

The National Transportation Safety Board determines that the probable cause of this incident was the failure of the flightcrew to follow standard climb procedures and to adequately monitor the aircraft's flight instruments. This resulted in the aircraft entering into a prolonged stall buffet which placed the aircraft outside the design envelope.

**BY THE NATIONAL TRANSPORTATION SAFETY BOARD**

/s/ ELWOOD T. DRIVER  
Vice Chairman

/s/ FRANCIS H. McADAMS  
Member

/s/ PATRICIA A. GOLDMAN  
Member

/s/ G. H. PATRICK BURSLEY  
Member

JAMES B. KING, Chairman, did not participate.

November 7, 1980

#### 4. APPENDIXES

##### APPENDIX A

#### INVESTIGATION AND HEARING

##### 1. Investigation

The National Transportation Safety Board was notified of the incident about 1400 e.s.t. on November 11, 1979, and dispatched an Investigator-in-Charge from the Safety Board's Miami office. Investigative **groups** were established for operations, **performance/flight** data recorder, and airworthiness. Information and reports were **also** obtained for weather, metallurgy, and powerplants.

Parties to the investigation were the Federal Aviation Administration, McDonnell Douglas Aircraft Corporation, and the General Electric Company, Inc.

This investigation was conducted in accordance with ICAO Annex 13 to the Convention on International Civil Aviation. The Mexican Government's accredited representative and advisors from AEROMEXICO and the International Airlines Pilot Association participated in the investigation.

##### 2. Hearing

There was no hearing.

APPENDIX B

PERSONNEL INFORMATION

Captain Rafael Breton Pamiagu

Captain Breton Pamiagu, 52, was employed by AEROMEXICO. He held a Mexican Transport Pilot Certificate No. 388 with ratings for DC-3, DC-6, DC-8, and DC-10 aircraft. His Mexican medical certificate as pilot-in-command (PIC) was issued October 4, 1979, with the limitation that he must have corrective lenses in his possession.

Captain Pamiagu completed his last DC-10 training and checkride on September 27, 1979, in accordance with AEROMEXICO's approved operations and training manuals. During his flying career, he had accumulated a total flying time of 18,824 hours, of which 2,796 hours were in DC-10 aircraft. He flew about 150 hours as PIC on DC-10 aircraft during the 90 days preceding the incident.

First Officer Fernando Benjamin Morales Hernandez

First Officer Morales Hernandez, 39, was employed by AEROMEXICO. He held a Mexican Transport Pilot Certificate No. 145 (restricted pilot-in-command or second-in-command (SIC)). He had TPR ratings in DH-6, DC-9, DC-8, and DC-10 aircraft. His Mexican medical certificate as a First Officer was issued June 5, 1979, with the limitations that he wear corrective lenses while flying.

First Officer Hernandez completed his last DC-10 training and checkride on May 28, 1979, in accordance with AEROMEXICO's approved operations and training manuals. During his flying career, he had accumulated a total flying time of 5,348 hours, of which 1,293 hours were in DC-10 aircraft. He flew about 90 hours as SIC within the 90 days preceding the incident.

Flight Engineer Armando Del Valle Calderon

Flight Engineer Del Valle Calderon, 51, was employed by AEROMEXICO. He held a Mexican Flight Engineer Certificate No. 14 with ratings for DC-8 and DC-10 aircraft. His Mexican medical certificate as flight engineer was issued on September 27, 1979, with the limitation that he wear corrective lenses while flying.

Flight Engineer Calderon completed his last DC-10 training and checkride on September 27, 1979. During his flying career, he had accumulated a total of 11,229 hours, of which 2,085 hours were in DC-10 aircraft. He flew about 100 hours as SIC within the 90 days preceding the incident.

APPENDIX C

AIRCRAFT INFORMATION

AEROMEXICO Airlines had operated McDonnell Douglas DC-10-30, S/N 46937, XA-DUH continuously since it was purchased from the Douglas Company on April 8, 1974. The aircraft had been in service 20,812 hours.

The aircraft's last major inspection was completed at 19,934 hours; its last Lirle Maintenance was completed at 20,775 hours and its last preflight was completed by the flight engineer before departed from Frankfurt, Germany, on November 11, 1979.


Its current Airworthiness Certificate No. 791360 was dated on July 4, 1979.

XA-DUH was equipped with three General Electric Model CF6-50C engines. Pertinent information pertaining to the engines is as follows:

	Engine No. 1	Engine No. 2	Engine No. 3
Serial No.	455-353	455-403	455-346
Total Hours	15,080	13,103	13,275
Time Since Overhaul	3,445	2,510	4,738

APPENDIX D

DFDR DATA GRAPH FOR ALTITUDE, IAS AND HEADING

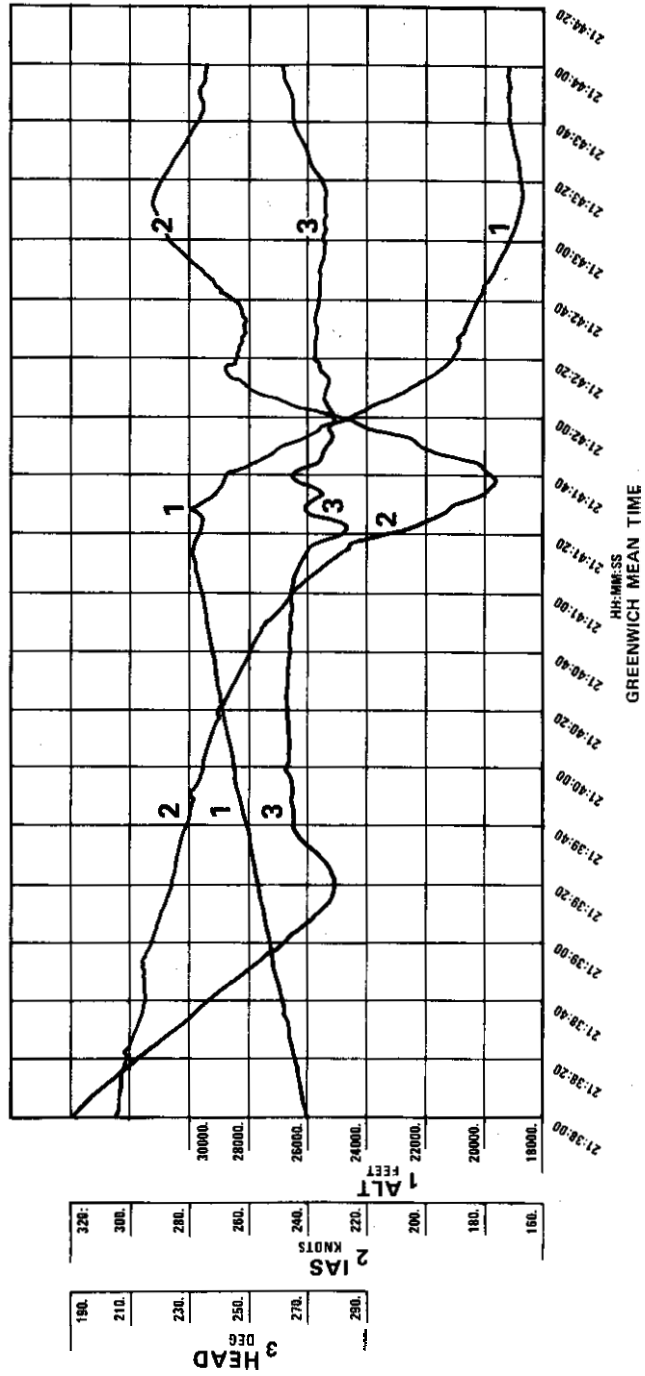


REORDER MM: SOC 573-A  
RECORDER SN: 2832  
IDENT. NO. : MIA-80-AA-78  
REPORT NO. : 80-6

LOCATION: OVER FRANCE  
DATE : 11-NOV-79  
AIRCRAFT: DC-10  
OPERATOR: AERMEXICO  
FLT. NO. : 945

APPENDIX E

DFDR DATA GRAPH FOR ALTITUDE, PITCH AND ROLL

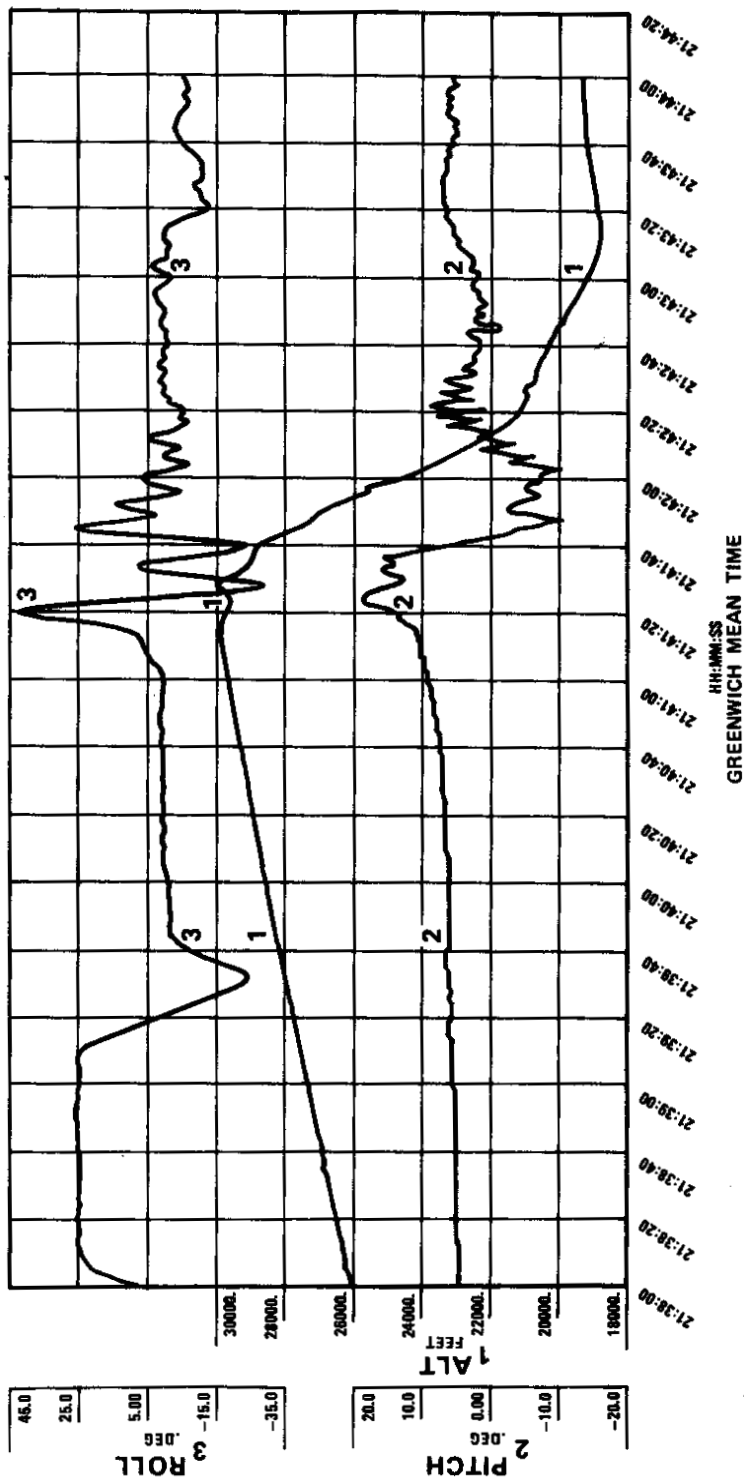

LOCATION: OVER FRANCE  
DATE : 11-NOV-79  
AIRCRAFT: DC-10  
OPERATOR: AEROMEXICO  
FLT. NO. : 945


RECORDER M/M: SDC 573-A  
RECORDER S/N : 2832  
IDENT. NO. : MIA-98-AA-011  
REPORT NO. : 806

DPDR DATA GRAPH FOR ALTITUDE, ELEVATOR, RUDDER AND AILERON

APPENDIX P

LOCATION: OVER FRANCE  
 DATE : 11-NOV-78  
 AIRCRAFT : DC-10  
 OPERATOR : AEROMEXICO  
 FLT. NO. : 945


RECORDER NAME: SDC 573-A  
 RECORDER S/N : 2832  
 IDENT. NO. : MIA-30-44-911  
 REPORT NO. : 806

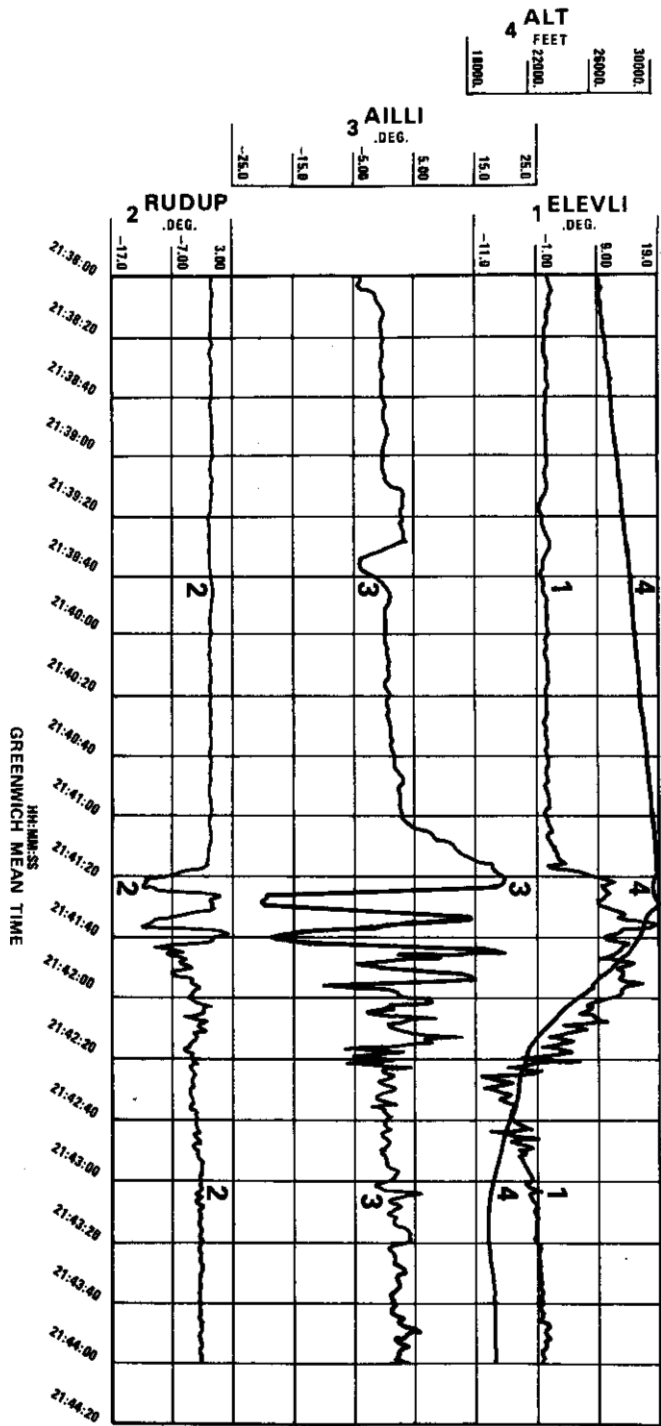



APPENDIX G

DFDR DATA GRAPH FOR ALTITUDE, N<sub>1</sub> FOR ALL ENGINES

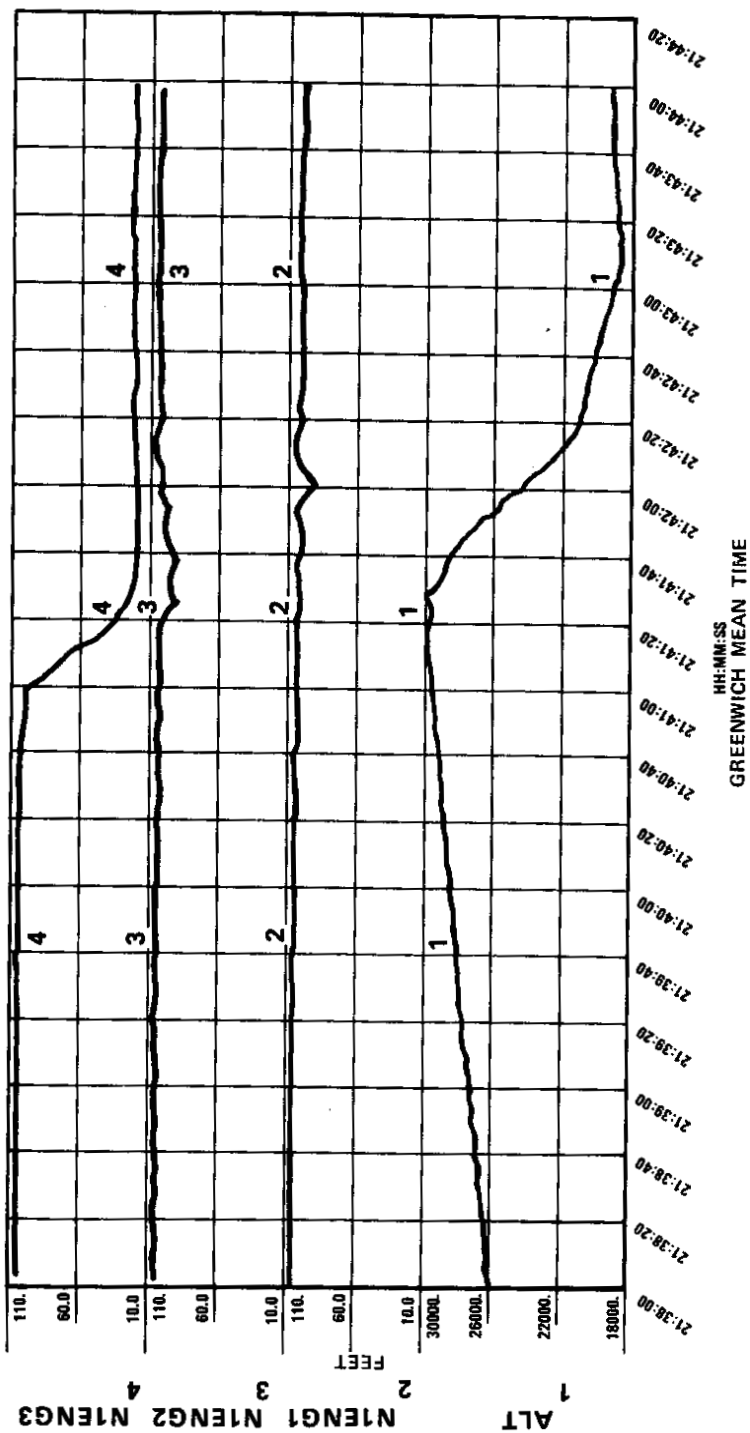

LOCATION: OVER FRANCE  
DATE : 11-NOV-78  
AIRCRAFT: DC-10  
OPERATOR: AEROMEXICO  
FLT. NO. : 945

RECORDER M/M: 11-NOV-78  
RECORDER S/N : 2632  
IDENT. NO. : MIA-80-AA-011  
REPORT NO. : 80-6